

SONY

Hi-Fi Products Service Bulletin

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: All CDP/CDP-C

No. 286R1

Subject: Will Not Play Disc / Skips After Optical Block Replacement




Date: November 24, 1992

This bulletin supersedes Hi-Fi Service Bulletin No.286

Symptom:
(12) Unit will not read TOC or unit will skip after optical block has been replaced.

Solution: Focus Bias is out of adjustment. Adjust focus bias pot on optical block KSS-240A as follows:

1. Use a YEDS-18 disc.
2. Adjust the focus bias pot for the clearest eye pattern.

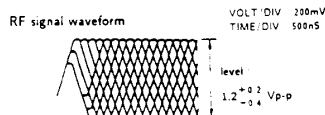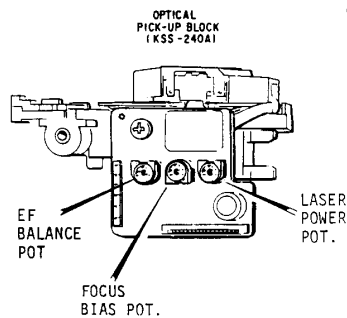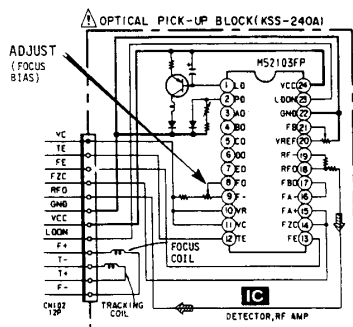

Clear RF signal waveform means that the shape "◇" can be clearly distinguished at the center of the waveform.

CSA-13 CDP General

Reference: Larry Gadbois



PRINTED IN U.S.A.
CSA-131192-2