

SONY

Hi-Fi Products
Service Bulletin

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: CDP-68/307ESD/750/950

No. 32

Subject: No Chucking Operation

Date: September 19, 1988


Symptom:
(**)

During the loading cycle, the disc will not be completely chucked. The optical section may swing upward only partially or perhaps not at all.

Cause: This is caused by the drive belt slipping.

Solution: Replace the former drive belt with a newer version drive belt. The part number is listed below:

Ref. No.	Description	Part Number	
		Former	New
123	Belt	4-917-522-01	4-917-522-02

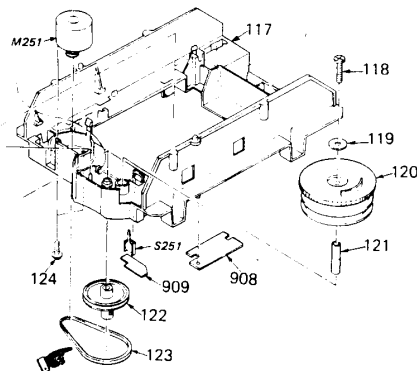

Compact Disc

CSA-13