

SONY

Hi-Fi Products
Service Bulletin

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: CDP-C225 / C325 / C425

No. 319

Subject: Portions Of The Display Are Constantly Lit

Date: February 10, 1993


Symptom:
(13)

Portions of the display are constantly lit when the unit is powered on. The Main PC board becomes loose from the finger snap hold down which holds it to the chassis. This results in the Main PC board shorting to the bottom metal case which causes problems with the display.

Solution:

Snap the Main PC board back onto the finger snap hold down and add a screw (type shown in the chart below) at the location shown in the drawing below.

DESCRIPTION	PART NUMBER
SCREW TAP +BV 3.0X8.0 BLK	7-685-646-79

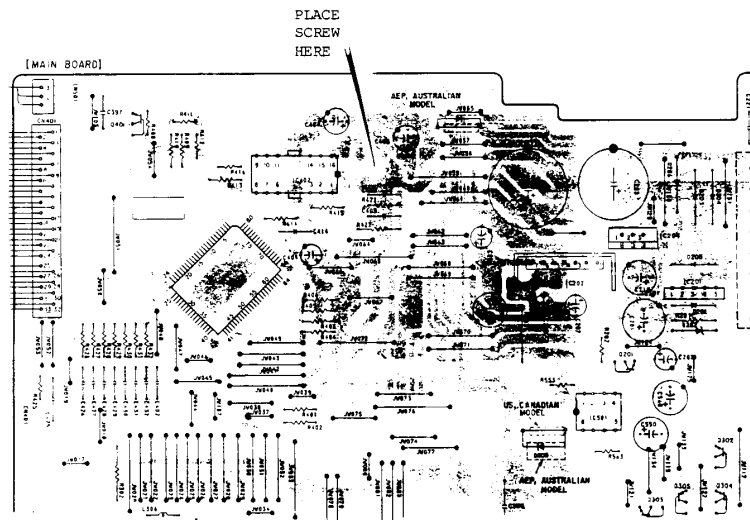

Reference: FPR-N2496
Auto-Flagging: YES

PRINTED IN U.S.A.
CSA -13193-7

CSA-13 CD Player