

SONY.

Hi-Fi Products
Service Bulletin

CSA-13

Sony Service Company - Technical Services
A Division of Sony Electronics Inc.
Sony Drive, Park Ridge, New Jersey 07656

Model: CDPC425

No. 381

Subject: A Whistling noise is heard when playing certain discs.


Date: March 4, 1994

Symptom:
(64)

A whistling noise can be heard from the mechanical assembly. The whistling noise is a result of vibration of the disc, optical lens, and the BU base which results in resonance that causes the noise. This noise occurs only with certain discs.

Solution:

To reduce the vibration of the BU base add the weight (4-962-979-01) to the optical block using a +PTP2.6X8 screw (7-685-134-19) in place of the original screw. See diagram below.

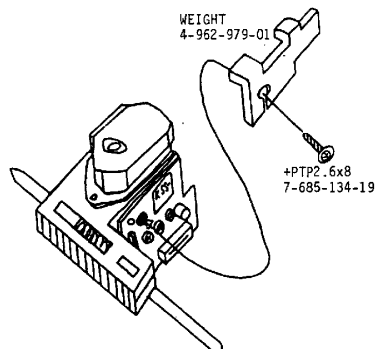

Reference: SEC DA-03093
Autoflagged - NO



PRINTED IN USA
CSA-13294-8