

SONY.**Hi-Fi Products
Service Bulletin****CSA-13**Sony Service Company - Technical Services
A Division of Sony Electronics Inc.
Sony Drive, Park Ridge, New Jersey 07656**Model:** CDP-C435
CDP-C535**No. 389****Subject:** Motor Drive Circuit Modification**Date:** April 26, 1994**Symptom:**
(62)

The BU assembly contacts the disc tray when attempting to load a disc.

Solution: Replace IC501 with the part listed below.

REF	FORMER		NEW	
	DESCRIPTION	PART NUMBER	DESCRIPTION	PART NUMBER
IC501	CXP82220-006Q	N/A	CXP82220-007Q	8-752-849-43

Verify the value of the following 1/4 watt resistors:

R552	2.4K ohm	P/N 1-247-840-00
R553	750 ohm	P/N 1-247-828-11
R554	1.2K ohm	P/N 1-249-418-11

If resistors of a different value are currently installed in these locations remove them, and replace with the proper value.

Applicable Serial numbers for CDP-C435, after 827158

Applicable Serial numbers for CDP-C535, after 819501

