

SONY

Technical Publications Department
SONY CORPORATION OF AMERICA
47-47 Van Dam Street, Long Island City, New York 11101

Date: October 15, 1973

hi-fi Service Bulletin No. 30

Model: **ST-5055**

Subject: Slipping Dial Cord

To correct a slipping dial cord, bend the pulley bracket at (★) in the illustration below about 1/8" upward. Check that the dial cord operates smoothly as the tuning knob is turned. If it does not, readjust the pulley bracket.

When the bracket has been set so that the cord runs without slipping or binding, tune to a known local fm station and set the dial pointer accurately to the station frequency.

This adjustment has been made to current-production units as listed below.

ST-5055: Serial No. 802,791 and higher

