PHILCO . . . . RADIO SERVICE BULLETIN No. 349

RADIO MANUFACTURERS SERVICE — Your Guarantee of Best Radio Service — A PHILCO SERVICE PLAN

Supplementary to Bulletins No. 344, 345, 346, 347

FOR MODELS 715, 41, 44 and 408

Various changes have been made in production on Philco Models 715, 41, 44 and 408 in order to improve their performance. The new schematic diagrams for these models are on the pages of this bulletin, and should be used instead of the similar diagrams appearing in bulletins numbered 344, 345, 346 and 347.

A few other changes should be made as described below.

BULLETIN No. 344

On Page 1, type 7C7 shown as Phono Amplifier should read 7C6.

On Page 10, Paragraph 16, delete the reference to crystal pick-up cartridge.

Parts Changes

Loop Aerial should be 76-1189 instead of 76-1124.
R.F. Choke should be 32-3615 instead of 32-3559.
Cone Assembly—cancel No. 25-0024.
Line Cord—add No. 03-0018.
Knob (Motor Switch)—add No. 07-0030.
Socket (6 prong tubes) should be No. 07-0044 instead of No. 27-6036.
Socket (Loktal) should be No. 27-6158 instead of No. 27-6131.
Tab Kit should be No. 20-0009 instead of No. 40-6500.

BULLETIN No. 345

Parts Changes

Speaker should be No. 36-1513-2 and No. 36-1513-4 instead of No. 36-1513.
Cone Assembly for No. 36-1513-2—use No. 36-4159-2.
Cone Assembly for No. 36-1513-4—use No. 36-4169.
Tab Kit—add No. 20-0009.

BULLETIN No. 346

Parts Changes

Cone Assembly should be No. 25-0024 instead of No. 36-4160.
Speaker should be No. 36-1515-2 instead of No. 36-1515.
Antenna Panel Assembly—add No. 38-9870.
Phono Plug—add No. 27-6149.

BULLETIN No. 347

Parts Changes

Cone Assembly should be No. 25-0030 instead of No. 36-4175.
Speaker should be No. 36-1526-2 instead of No. 36-1526-3.
Coil Mtg. Clips—add No. 28-5002.

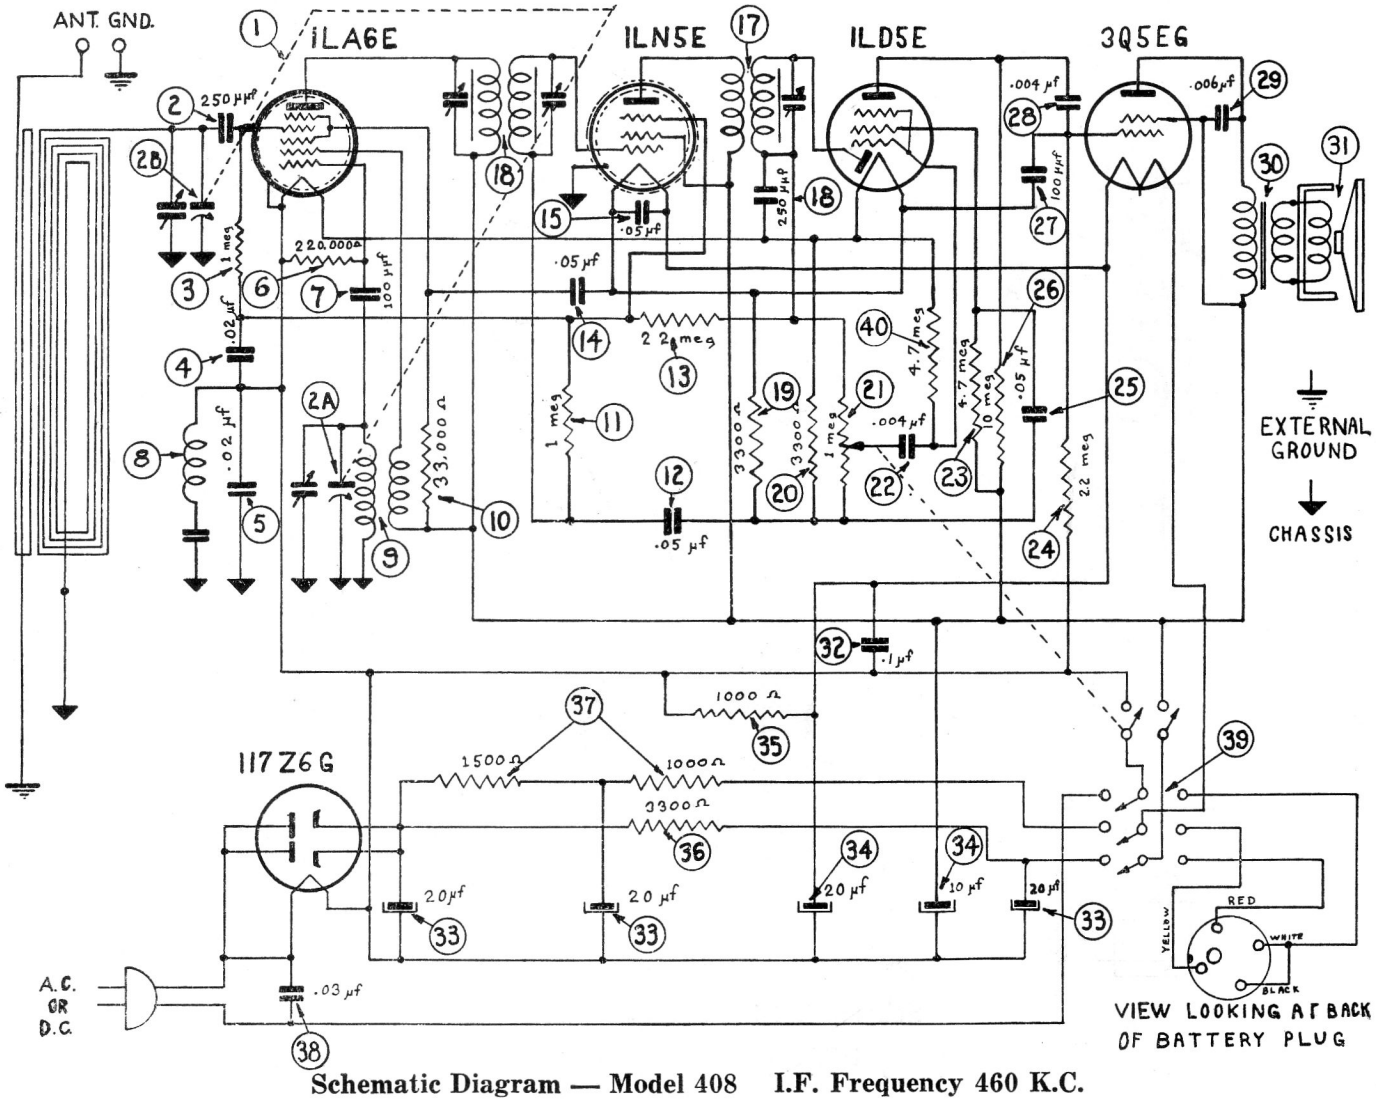

Schematic Diagram — Model 408 I.F. Frequency 460 K.C.

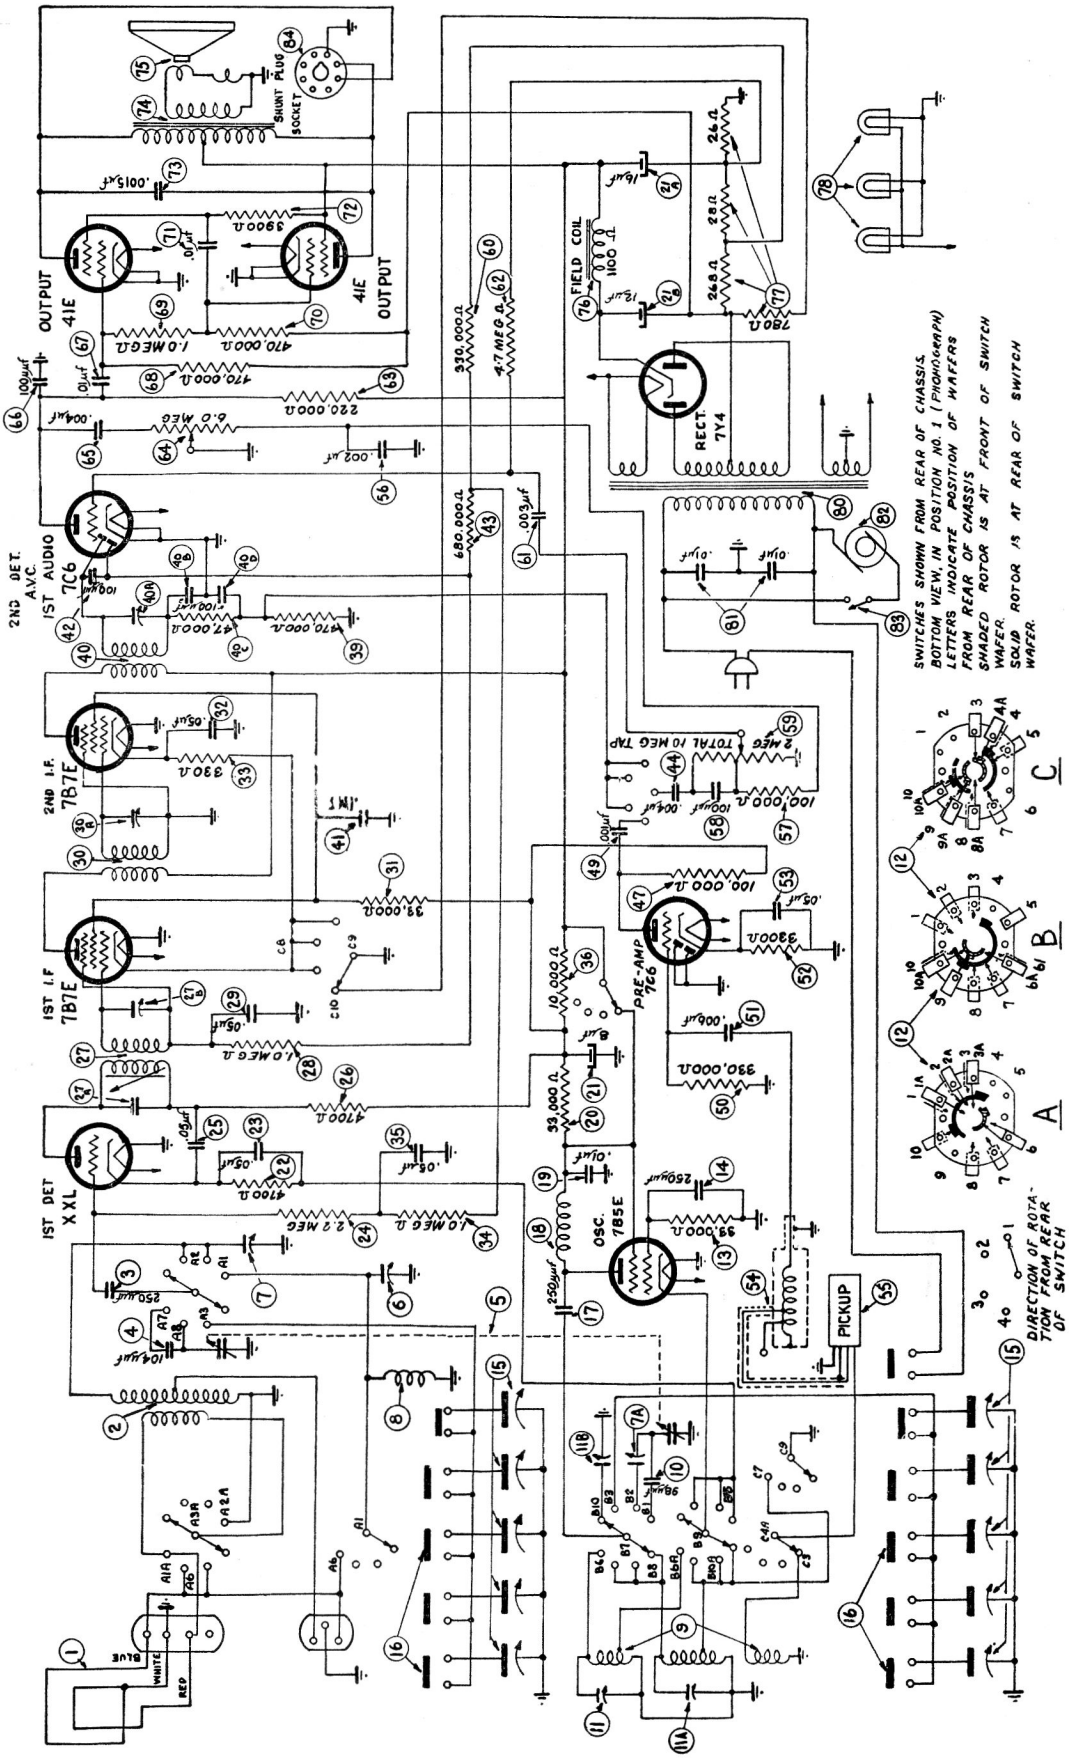

Schematic Diagram — Model 715

I.F. Frequency 460 K.C.

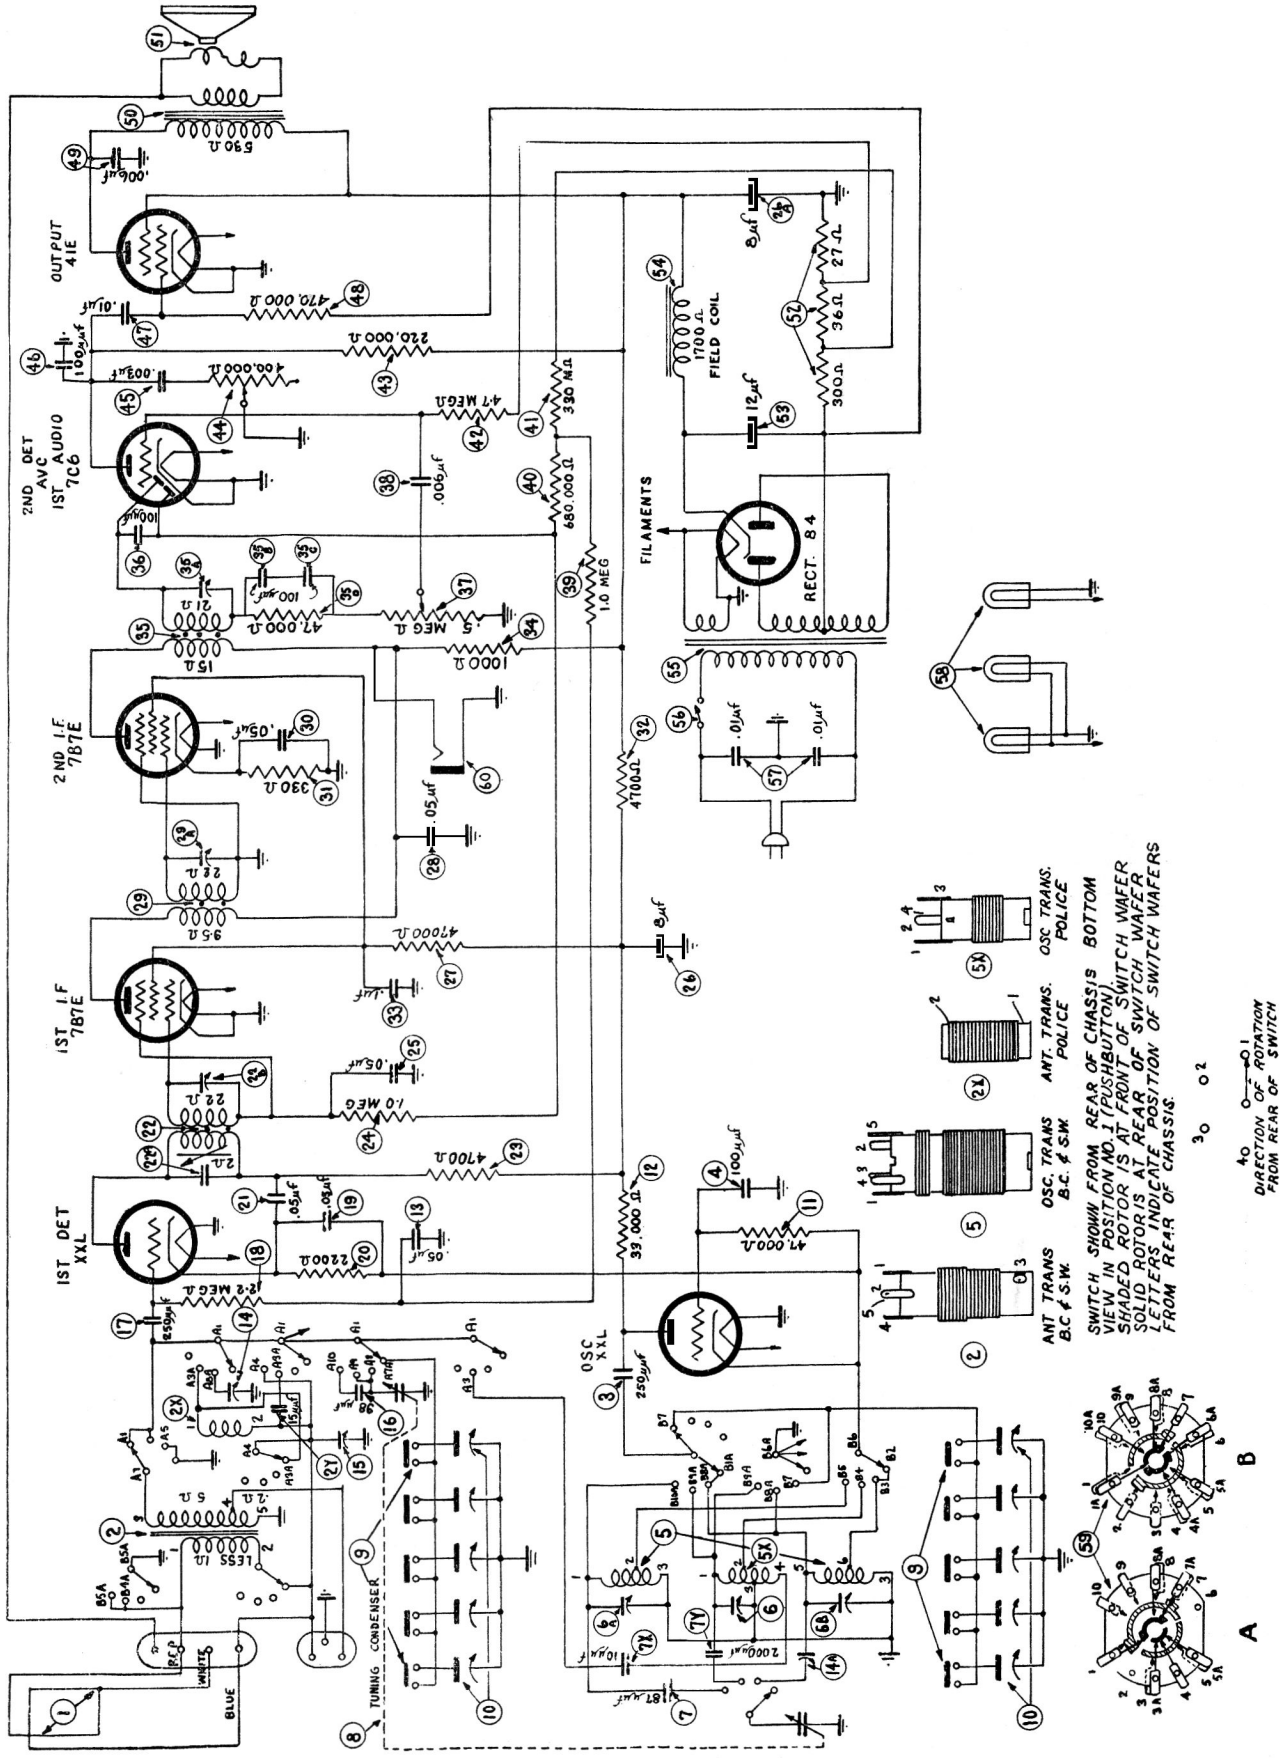

Schematic Diagram — Model 41

I.F. Frequency 460 K.C.

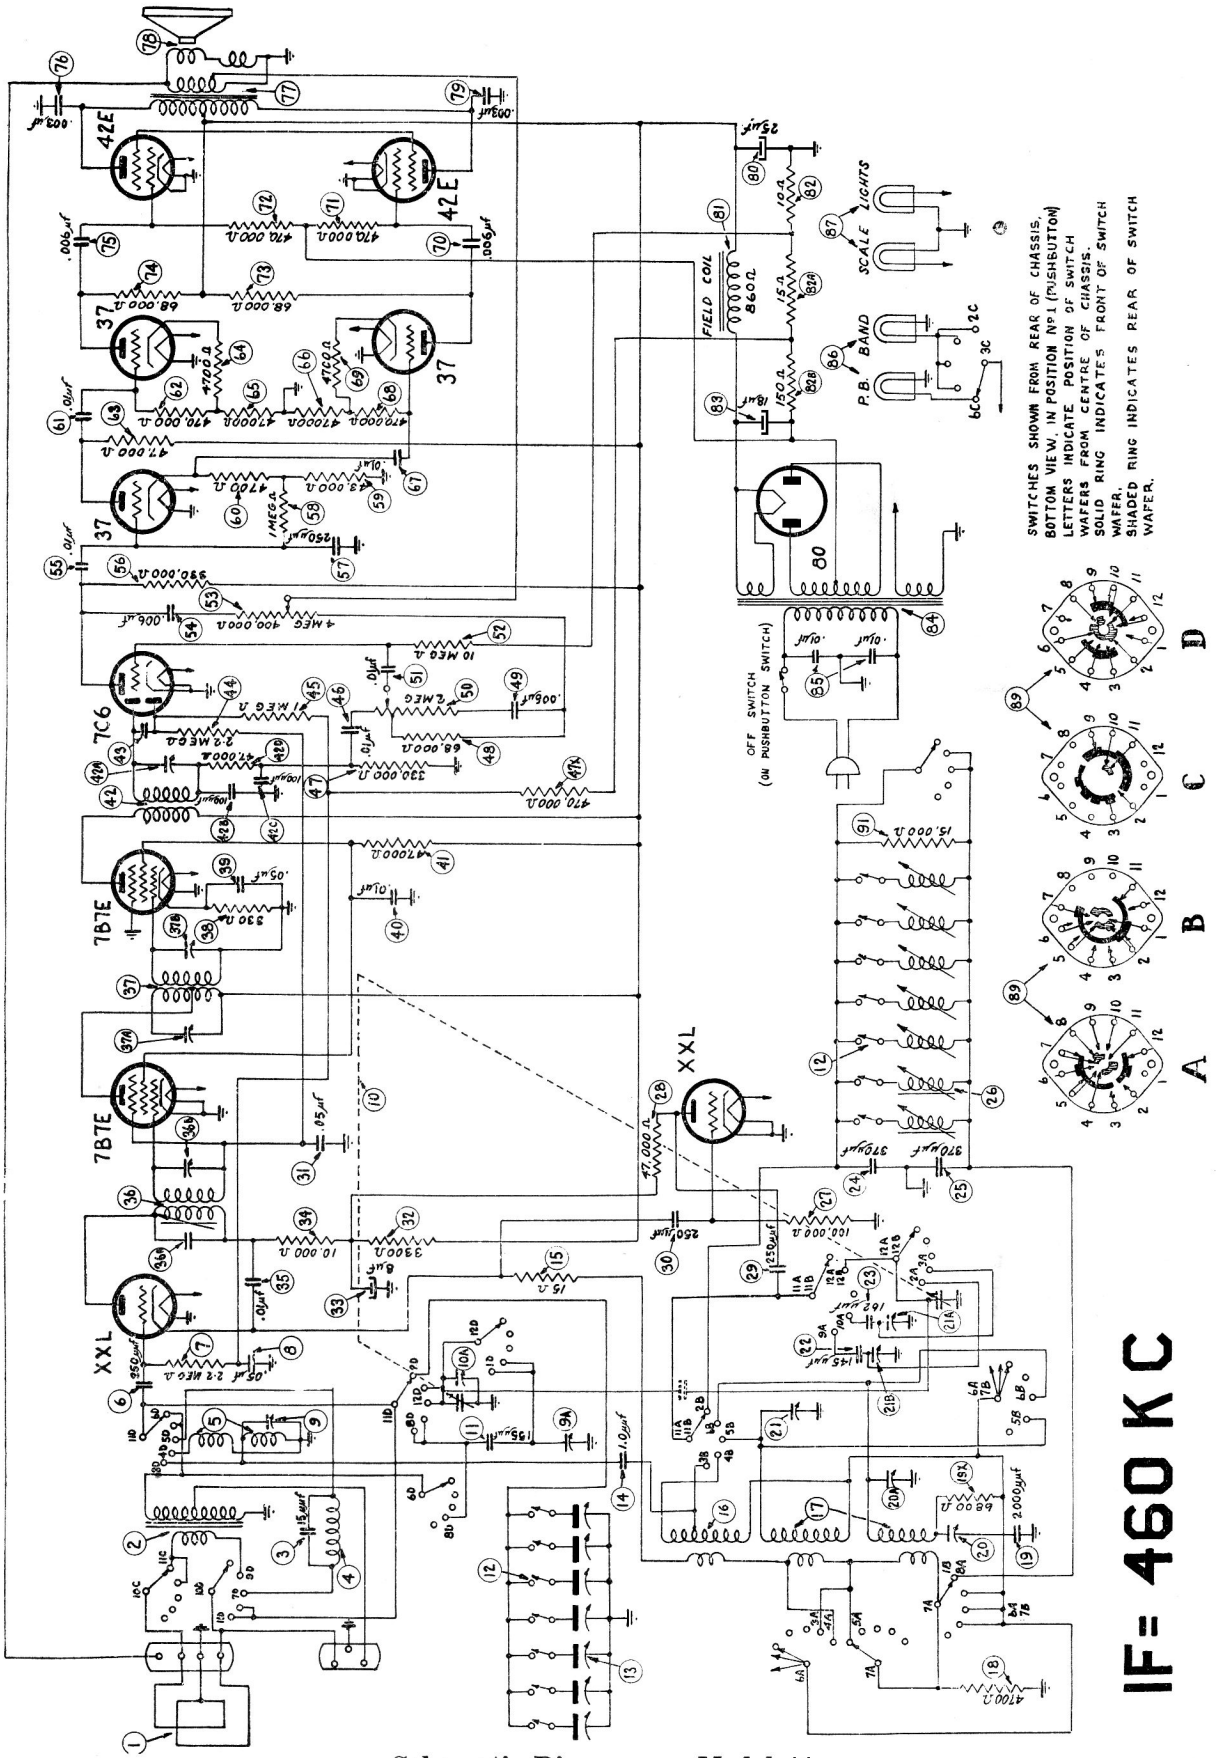

Schematic Diagram — Model 44
I.F. Frequency 460 K.C.