

**SONY**

## Hi-Fi Products Service Bulletin

Sony Service Company - Technical Services  
A Division of Sony Corporation of America  
Sony Drive, Park Ridge, New Jersey 07656

**Model:** CDP-C100/C15ESD/C9ESD/C90ES/C900  
/C910

**No. 311**

**Subject:** New Type Disc Magazine Will Not Eject

**Date:** December 31, 1992


**Symptom:**  
(62)

The new type XA-10B disc magazine will not eject from the unit consistently.

**Solution:**

Since the new type XA-10B disc magazine has a slightly higher profile, you must bend the tabs on the mechanism housing (see drawing) which are located just above where the cartridge is inserted into the machine to provide clearance.

*Note: Bend tabs to the point where the disc magazine will consistently eject from the unit.*

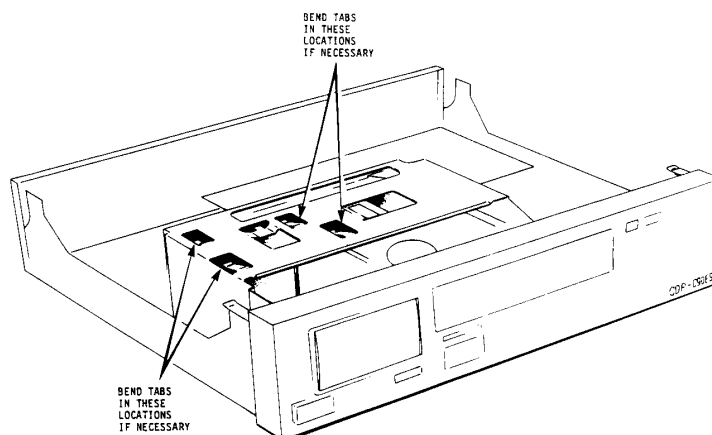

CSA-13 CD Player

Reference: FPR-N2193



PRINTED IN U.S.A.  
CSA-131292-8