

SONY.

Hi-Fi Products
Service Bulletin

CSA-13

Sony Service Company - Technical Services
A Division of Sony Electronics Inc.
Sony Drive, Park Ridge, New Jersey 07656

Model: CDP-411

No. 397

Subject: "No Disc" Appears during Play

Date: June 24, 1994


Symptom:
(51)

During the Continuous play mode a "No Disc" indication will appear in the display.

Solution:

Change the value of the parts listed below.

REF	FORMER		NEW	
	DESCRIPTION	PART NUMBER	DESCRIPTION	PART NUMBER
R304	1K OHM	1-249-417-11	330 OHM	1-249-411-11
R302	1K OHM	1-249-417-11	470 OHM	1-249-413-11

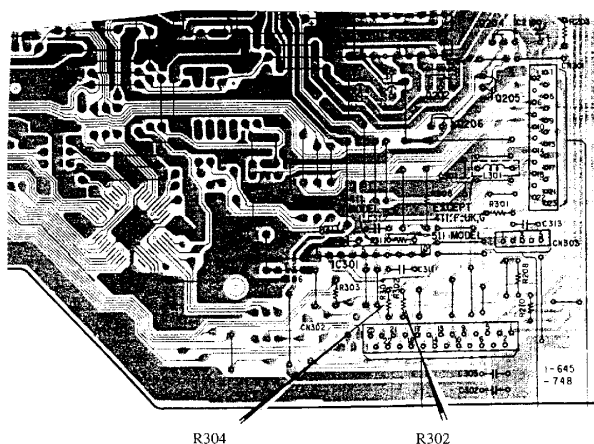

Reference: Tech News AU-94012
Autoflagged - NO



PRINTED IN USA