

SONY®

Hi-Fi Products Service Bulletin

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: STR-VX550

No. 3

Subject: Missing 1S1555 Diode

Date: January 28, 1988

Symptom:


(151)

(151)
Early production of STR-VX550 diode 1S1555 was omitted from the display board.

Solution:

Solution:
When servicing STR-VX550, check if this diode is installed. If the diode is missing, solder a 1S1555 between collector of Q308 and base of Q305. The cathode should be connected to the collector of Q308.

Add Diode 1S1555
Part No. 8-719-815-55

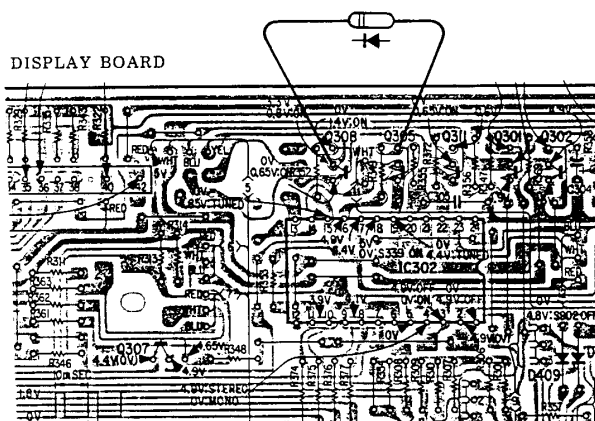

Receiver

CSA-13

Reference:

PRINTED IN U.S.A.
CSA-13288-1